

Operating Principles

The Discrete Interval Sampler (DIS) allows samples to be taken from distinct levels within a well. The sampler is pressurized at the surface to prevent water from entering the device as it is being lowered to the desired sampling depth. The pressure is then released allowing the Sampler and tubing to fill under hydrostatic pressure. The Sampler is repressurized to maintain chemical stability of the sample as the Discrete Interval Sampler is retrieved.

SAFETY PRECAUTION Using High Operating Pressures can be Dangerous

For sampling at depths greater than 200 ft. (60 m) below water level use the following method to increase safety.

Before Sampling: Pressurize the sampler to 100 psi (700 kPa) then lower the sampler to a depth of about 160 ft. (50 m) below water.

At that level increase the pressure to the maximum required, as determined when setting the operating pressure. Then lower the sampler to the appropriate level and continue as per the operating instructions.

After Sampling: Raise the sampler to a depth of about 160 ft. (50 m) below water, then decrease the pressure on the sampler to 100 psi (700 kPa). Continue to raise the sampler and follow the instructions to properly remove the sample.

Recommended Operating Pressure

Depth (ft.) below water	Pressure psi	Depth (m) below water	Pressure KPa
25	20	7.6	145
50	30	15.2	220
100	50	30.5	370
200	95	61.0	670
300	140	91.4	965

Discrete Interval Sampler Size & Capacity Options

Size	Capacity	Size	Capacity
1" x 2 ft.	6 oz	25.4 mm x 610 mm	175 ml
1.66" x 2 ft.	15 oz	38 mm x 610 mm	450 ml
2" x 2 ft.	27 oz	50.8 mm x 610 mm	800 ml

Sampling with the Discrete Interval Sampler

- Notes:**
1. The Sample Release Device NEVER goes down the well.
 2. A safety support line should always be used to lower the Sampler

1. Before using the Discrete Interval Sampler, there are two important pieces of information needed:
 - i) Desired Sampling Depth
 - ii) Static Water Level
2. With the tubing connected to the Discrete Interval Sampler, (see Assembly on Page 2) and the air pump assembled, connect the air pump to the Pressure Inlet.
3. Turn the Pressure/Vent Valve to Pressure.
4. At this point you must make a calculation to ensure that you are operating at the proper pressure using one of the following formulas, or the chart at lower left.

Setting the Operating Pressure

Feet	Meters
Sampler depth below grade (ft.) - static water level below grade (ft.) x 0.43 + 10 psi	Sampler depth below grade (m) - static water level (m) x 9.8 + 70 kPa
Example	
Sampling Depth is 100 ft. - Static Water Level at 30 ft. x 0.43 + 10 psi = 40 psi Therefore the Discrete Interval Sampler should be pressurized to 40 psi for proper operation.	

5. Using the air pump, pressurize the Discrete Interval Sampler to the proper pressure.
6. Disconnect the air pump from the reel before lowering into the well.
7. Use a safety support line, such as the Model 103 Tag Line, to lower the DIS to the proper sampling depth. (See Model 103 Data Sheet).
8. Once the sampler is at the desired sampling depth, turn the Pressure/Vent Valve to Vent. Wait for 1-3 minutes to allow the Discrete Interval Sampler to fill
9. Turn the Pressure/Vent Valve to Pressure.
10. Connect the air pump to the Pressure Inlet on the reel and repressurize the system as determined in step 4.
11. Once pressurized, disconnect the air pump and bring the sampler to the surface following the "Safety Precaution" described above.
12. When the sampler is at the surface you are ready to retrieve your sample, turn the Pressure/Vent Valve to Vent.
13. Hold the Discrete Interval Sampler over your sample bottle and press the Sample Release Device Stem up into the Decanter Body until sample begins to flow from the sampler. The flow rate can be regulated by simply adjusting the amount of the Stem inserted into the Decanter Body.


- Note:** If no sample is coming out of the Discrete Interval Sampler, loosen the Compression Fitting to allow venting and then take your sample.

Assembly

Note: The PTFE check ball sinks in water. The Polypropylene check ball floats in water.

1. If required, a small (2 mm) Allen key can be used to tighten and/or loosen the Barb Fitting and Safety Line Bracket on the Upper Check Ball Body. There should be a V-006 o-ring on the Barb Fitting.
2. Ensure there is a V116 o-ring installed on the Upper Check Ball Body and place a V-203 o-ring inside the Upper Check Ball Body.
3. Place the Polypropylene check ball in the Check Ball Retainer and press the Check Ball Retainer into the Upper Check Ball Body.
4. Thread the Upper Check Ball Body assembly into the top of the Upper Platen until it is finger tight.
5. Ensure there are two V-131 o-rings installed on the Upper Platen and thread the Rod Connector into the bottom of the Upper Platen.
6. Ensure there is a V-116 o-ring installed on the Decanter Body and push the V-010 o-ring and V-203 o-rings inside the Decanter Body.
7. Place the PTFE check ball in the Check Ball Retainer and press the Check Ball Retainer into the Decanter Body.
8. Thread the Decanter Body assembly into the Bottom Platen until it is finger tight.
9. Ensure there are two V-131 o-rings installed on the Bottom Platen and thread the Bottom Platen assembly onto the Rod Connector.
10. Thread one end of the Retaining Rod about halfway into the Upper Platen assembly.
11. Insert the Upper Platen assembly into the Sampler Body and thread the other end of the Retaining Rod into the Bottom Platen assembly.
12. Thread the Upper Platen and Bottom Platen assemblies into the Sampler Body until both Platens are tight to the Sampler Body.
13. Push the tubing onto the Barb Fitting. Check the connection by pulling firmly on the tubing. It should not pull off of the fitting.

Note: Use an awl to open the very tip of the tubing, or heat the tubing to help push it completely over all the barbs.

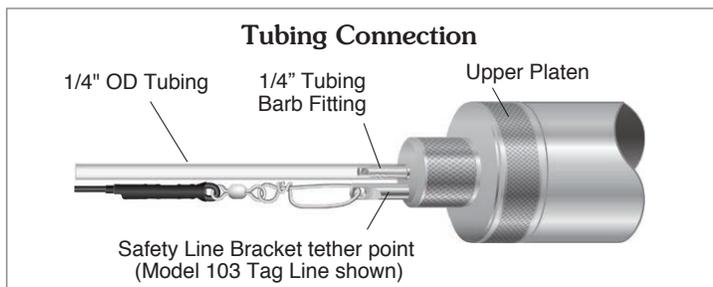


Decontamination

Note: Always follow your local guidelines and standard protocols. Replace worn o-rings.

The DIS should be decontaminated after each sampling event.

1. Disassemble the DIS and wash all parts in a phosphate-free soap.
2. Rinse all parts thoroughly with deionized water and dry.
3. Reassemble the Sampler.

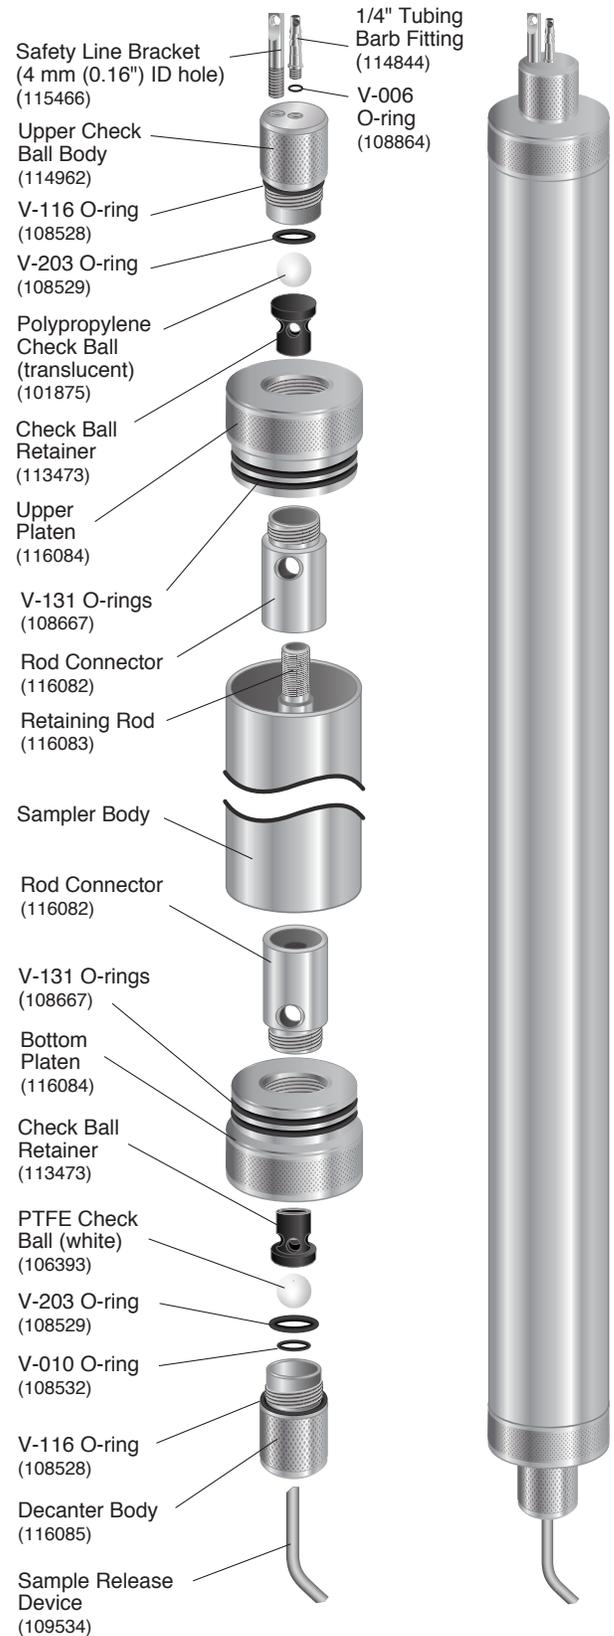

Model 425 Mk3 2" x 2 ft. Discrete Interval Sampler (115012)